



---

## North Coast Regional Water Quality Control Board

January 14, 2020

Jalal Ahmad Tahir  
907 Teatro Circle  
El Cajon, CA 92021

Certified Mail No. 7016 0750 0001 0048 6542

Dear Mr. Tahir:

**Subject: Notice of Violation, Directive to Obtain Regulatory Coverage for Cannabis Cultivation, and Transmittal of Inspection Report for September 4, 2019, Inspection of Humboldt County Assessor's Parcel Nos. 315-173-004 and 315-174-003**

**File:** Cannabis Inspections, Humboldt County, 2019, 190904 Jalal Tahir 315-173-004 and 315-174-003, CIWQS Place ID No. 8282457

This letter is to notify you of observed violations of the requirements listed below for unauthorized discharges to waters of the state from the above-referenced parcel (Property):

1. California Water Code (Water Code) sections 13260 and 13264
2. Water Quality Control Plan for the North Coast Region (Basin Plan) section 4.2.1 Prohibitions 1 and 2

This letter directs you, within 30 days, to take action to comply with Water Code 13260. In addition, this letter directs you, within 30 days, to contact Regional Water Board staff to advise of your plan to implement recommendations in the attached report.

### **A. Background**

On September 4, 2019, staff from the Regional Water Board, accompanied by staff of the California Department of Fish and Wildlife (CDFW), State Water Resources Control Board Division of Water Rights, Humboldt County HAZMAT, and various law enforcement personnel, inspected the subject Property.

The purpose of the inspection was to evaluate onsite development and conditions,

VALERIE L. QUINTO, CHAIR | MATTHIAS ST. JOHN, EXECUTIVE OFFICER

and to identify and assess any impacts or threatened impacts to the quality and beneficial uses of waters of the state.

Attached is a copy of the water quality inspection report (September 4, 2019 Inspection Report). Please review the Inspection Report carefully and completely. The Inspection Report contains recommendations for correcting observed violations and water quality concerns observed on the Property, and advises you of the Regional Water Board permits necessary for instream work and projects/activities that result in discharges of waste to receiving waters.

## **B. Relevant Requirements**

During the inspection, Regional Water Board staff observed features and conditions on the Property that represent violations of water quality requirements and regulations. Attachment A – Regulatory Citations, provides references to these requirements and regulations.

## **C. Observed Violations**

As documented in the September 4, 2019 Inspection Report, Regional Water Board staff observed cannabis cultivation and associated site disturbance of sufficient size and scope to require regulatory coverage under State Water Resources Control Board (State Water Board) Order No. WQ-2019-0001-DWQ, *General Waste Discharge Requirements and Waiver of Waste Discharge Requirements for Discharges of Waste Associated with Cannabis Cultivation Activities* (Statewide General Order). The Regional Water Board has no record of this Property's enrollment under the Statewide General Order. Outdoor cannabis cultivation activities in California with land disturbance of 2,000 square feet or more that are not enrolled for coverage under the Statewide General Order or individual waste discharge requirements violate Water Code section 13260. Staff also observed violations of Water Code sections 13260, 13264, and/or Basin Plan section 4.2.1 Prohibitions 1 and 2 at the Property locations identified as SC1, SC2, SC3, Surface flow, and Point of diversion in the September 4, 2019, inspection report.

## **D. Additional Potential Liabilities**

The Regional Water Board is in the process of considering whether the violations of the Water Code and the Basin Plan warrant further enforcement. We encourage you to take steps, to correct the violations as soon as possible, securing any applicable permits from this and other agencies prior to conducting work. Please note that the existing conditions, as observed and documented in the Inspection Report, may represent continuing violations of the Water Code and Basin Plan.

Please note that correcting the conditions of non-compliance at the Property does not preclude enforcement for the violations alleged in this notice. As noted above, the Regional Water Board reserves its right to fully enforce the law against any violation and

threatened violation by taking enforcement actions such as a cleanup and abatement order, time schedule order, administrative civil liabilities, and referral to the California Attorney General's office. Administrative civil liabilities may be assessed on a daily basis in the amount up to \$5,000 for each day the violation occurs or up to \$10 per gallon, but not both pursuant to Water Code section 13350.

#### **E. Directive to Obtain Regulatory Coverage**

Based on the observations detailed in the attached inspection report, and mentioned above, the Regional Water Board has determined that you are required to comply with Water Code section 13260 by taking one of the following actions within **30 calendar days of this letter**:

- 1) Enroll the property under the Statewide General Order by providing the information required in the online application process. The application can be accessed at this link: [https://www.waterboards.ca.gov/water\\_issues/programs/cannabis/](https://www.waterboards.ca.gov/water_issues/programs/cannabis/)

Submit the application fee within **30 days** of submitting the on-line application. Failure to submit the application fee within 30 days will result in the application being voided and authorization terminated. Payments shall be identified using the Fee Payment Application Number (found on the Notice of Receipt). All checks or money orders shall be made payable to: "State Water Resources Control Board," and shall be delivered to:

(By US Mail):

Accounting Office  
Attn: Water Quality Fees –  
Cannabis General Order  
P.O. Box 1888  
Sacramento, CA 95812-1888

(In person or by courier delivery):

Accounting Office  
Attn: Water Quality Fees –  
Cannabis General Order  
1001 I Street  
Sacramento, CA 95814-2828

- 2) File a Report of Waste Discharge in order to obtain individual Waste Discharge Requirements (WDRs) specific to your property.

Please submit the appropriate documents and payments to:

North Coast Water Board  
Attn: Diana Henriouille  
Enforcement Unit  
5550 Skylane Boulevard, Suite A  
Santa Rosa, CA 95403

**OR**

- 3) If you believe regulatory coverage is not required under either of the options listed above, either because you and/or your tenants elect to not resume or continue cannabis cultivation or associated activities, or because the operations that are occurring are not subject to regulation under the Statewide General Order or individual WDRs, please provide a written response explaining your non-applicability (with all supporting documentation including photos if necessary) to the Regional Water Board at the address provided above. Regional Water Board staff may contact you to verify your response.

Water Code section 13260 states, in relevant part:

(a) Each of the following persons shall file with the appropriate regional board a report of the discharge, containing the information which may be required by the regional board:

- (1) Any person discharging waste, or proposing to discharge waste, within any region that could affect the quality of the waters of the state, other than into a community sewer system.

Water Code section 13264 states, in relevant part:

(a) No person shall initiate any new discharge of waste or make any material changes in any discharge...prior to the filing of the report required by Section 13260 and no person shall take any of these actions after filing the report but before whichever of the following occurs first:

- (1) The issuance of waste discharge requirements pursuant to Section 13263.

Failure to comply with Water Code sections 13260 and 13264 may result in an administrative civil liability under Water code sections 13261 and 13265 not to exceed \$1,000 per violation for each day in which each violation occurs.

## **F. Inspection Report Recommendations**

As mentioned above, the September 4, 2019, inspection report provides recommendations to correct violations, as well as to address features and conditions that threaten to impact water quality.

Within 30 days of this letter, please advise Ermias Berhe of your intentions, plan, and schedule to implement recommendations in the inspection report. Ermias can be reached at (707)445-6128 or, by email at [Ermias.Berhe@waterboards.ca.gov](mailto:Ermias.Berhe@waterboards.ca.gov).

Future correspondence regarding this matter will be sent to you at this address unless an alternative address is provided to the Regional Water Board. Failure to accept mail from the Regional Water Board is not a valid excuse for non-compliance with any future enforcement orders, and a failure to respond or otherwise appear at a future enforcement proceeding could subject you to a default order and the imposition of administrative civil liability.

If you have any questions regarding this matter, please contact Ermias Berhe at the telephone number or email above. You may also contact me at [Diana.Henrioulle@waterboards.ca.gov](mailto:Diana.Henrioulle@waterboards.ca.gov) or by telephone at (707) 576-2350. Additionally, we are available to meet with you if you wish to discuss this letter, the inspection report, or our waste discharge regulatory programs in further detail.

Sincerely,

Diana Henrioulle, P.E.  
Enforcement Unit

200114\_EAB\_dp\_Jalal Ahmad Tahir Inspection\_NOV

Attachments: Attachment A – Regulatory Citations  
September 4, 2019, Water Quality Inspection Report

**cc: Humboldt County**  
[PlanningBuilding@co.humboldt.ca.us](mailto:PlanningBuilding@co.humboldt.ca.us)

**Department of Fish and Wildlife**  
Cheri Sanville, [Cheri.Sanville@wildlife.ca.gov](mailto:Cheri.Sanville@wildlife.ca.gov)  
Kalyn Bocast, [Kalyn.Bocast@wildlife.ca.gov](mailto:Kalyn.Bocast@wildlife.ca.gov)

**North Coast Regional Water Quality Control Board**  
Kason Grady, [Kason.Grady@waterboards.ca.gov](mailto:Kason.Grady@waterboards.ca.gov)

**State Water Resources Control Board Division of Water Rights**  
Stormer Feiler, [Stormer.Feiler@waterboards.ca.gov](mailto:Stormer.Feiler@waterboards.ca.gov)  
Akiko Masuda, [Akiko.Masuda@waterboards.ca.gov](mailto:Akiko.Masuda@waterboards.ca.gov)  
David Rosas, [David.Rosas@waterboards.ca.gov](mailto:David.Rosas@waterboards.ca.gov)

### Attachment A – Regulatory Citations

Regulatory Section	Citation
Basin Plan Section 4.2.1, Prohibition 1	Prohibits “[t]he discharge of soil, silt, bark, slash, sawdust, or other organic and earthen material from any logging, construction, or associated activity of whatever nature into any stream or watercourse in the basin in quantities deleterious to fish, wildlife, or other beneficial uses.”
Basin Plan Section 4.2.1, Prohibition 2	Prohibits “[t]he placing or disposal of soil, silt, bark, slash, sawdust, or other organic and earthen material from any logging, construction, or associated activity of whatever nature at locations where such material could pass into any stream or watercourse in the basin in quantities which could be deleterious to fish, wildlife, or other beneficial uses.”
California Water Code Section 13260	<p>“(a) Each of the following persons shall file with the appropriate regional board a report of the discharge, containing the information that may be required by the regional board:</p> <p style="padding-left: 40px;">(1) A person discharging waste, or proposing to discharge waste, within any region that could affect the quality of the waters of the state, other than into a community sewer system.</p> <p style="padding-left: 40px;">(2) A person who is a citizen, domiciliary, or political agency or entity of this state discharging waste, or proposing to discharge waste, outside the boundaries of the state in a manner that could affect the quality of the waters of the state within any region.”</p>
California Water Code Section 13261(a)	“A person who fails to furnish a report or pay a fee under Section 13260 when so requested by a regional board is guilty of a misdemeanor and may be liable civilly in accordance with subdivision (b).”
California Water Code Section 13264 (a)	“No person shall initiate any new discharge of waste or make any material changes in any discharge, or initiate a discharge to, make any material changes in a discharge to, or construct, an injection well, prior to the filing of the report required by Section 13260 and no person shall take any of these actions after filing the report but before whichever of the following occurs first:”

Regulatory Section	Citation
California Water Code Section 13265(a)	“Any person discharging waste in violation of Section 13264 , after such violation has been called to his attention in writing by the regional board, is guilty of a misdemeanor and may be liable civilly in accordance with subdivision (b). Each day of such discharge shall constitute a separate offense.”
California Water Code Section 13350	“A person who (1) violates a cease and desist order or cleanup and abatement order hereafter issued, reissued, or amended by a regional board or the state board, or (2) in violation of a waste discharge requirement, waiver condition, certification, or other order or prohibition issued, reissued, or amended by a regional board or the state board, discharges waste, or causes or permits waste to be deposited where it is discharged, into the waters of the state, or (3) causes or permits any oil or any residuary product of petroleum to be deposited in or on any of the waters of the state, except in accordance with waste discharge requirements or other actions or provisions of this division, shall be liable civilly, and remedies may be proposed, in accordance with subdivision (d) or (e).”



---

## North Coast Regional Water Quality Control Board

TO: Diana Henriouille

FROM: Ermias Berhe

DATE: October 29, 2019

### **Inspection Report for September 04, 2019, Warrant Inspection Humboldt County Assessor's Parcel Numbers 315-173-004 and 315-174-003**

File: Cannabis Program Inspections, Humboldt County, September 2019 HCSO  
CAMP Inspections, Jalal Ahmad Tahir, CIWQS Place ID 828457

#### **Property information:**

County: Humboldt

Physical address: Unknown address on Last Chance Ridge near intersection with Devil's Canyon, approximately 8 miles northwest of Hyampom.

APNs: **315-173-004 AND 315-174-003**

Owner: Jalal Ahmad Tahir  
907 Teatro Circle  
El Cajon, CA 92021

Transaction History (per LandVision): Last transaction for both parcels recorded September 23, 2016, from sellers The Richard Allen and Barbara Mae Jungwirth Trust and Barbara Mae Jungwirth.

Size: Parcel -174-003: 43.5 acres; parcel -173-004: 123 acres.

Watershed: Trinity River Hydrologic Unit; South Fork Trinity River Hydrologic Area; Grouse Creek Hydrologic Sub Area (HU/HA/HSA 106.21; Table 2-1, Water Quality Control Plan for the North Coast Region).

Aerial Imagery Notes (Google Earth Pro): Roads and roadside landings (apparently wide road segments) visible throughout both parcels, with no significant changes through the available imagery from June 1993 to most recent, May 2016.

---

VALERIE L. QUINTO, CHAIR | MATTHIAS ST. JOHN, EXECUTIVE OFFICER

**Regulatory status with the Regional Water Board:**

Site Development: N/A

Applicable programs: 401 Water Quality Certification

Onsite activities/operations: Enrolled under Regional cannabis order No. R1-2015-0023 effective December 6, 2016. No annual report submitted for 2017; NOV for SMR non-submittal issued 2018. No record of transition to statewide cannabis order.

Applicable programs: Cannabis cultivation waste discharge regulatory program, State Water Board Order WQ 2017-0023-DWQ (statewide cannabis order).

**Inspection information:**

Date/time: September 04, 2019

Type: Humboldt County Sheriff's Office (HCSO)/Campaign Against Marijuana Planting (CAMP) Warrant Inspection

**Attendance:**

Kalyn Bocast, ES, California Department of Fish and Wildlife (CDFW)  
Akiko Masuda, ES, Division of Water Rights (DIV)  
David Rosas, ES, Division of Water Rights (DIV)  
Adona White, WRCE, North Coast Regional Water Quality Control Board (NCRWQCB)  
Ermias Berhe, Engineering Geologist, (NCRWQCB)  
Humboldt County HAZMAT  
Multiple Law Enforcement Officials (LEO), HCSO  
Multiple LEOs, CAMP  
Multiple LEOs, CDFW

**Background/Objective:**

North Coast Regional Water Board (Regional Water Board) staff participated with staff of the Humboldt County Sheriff's Office (HCSO), California Department of Fish and Wildlife (CDFW), State Water Board's Division of Water Rights (DIV), , and personnel from various law enforcement agencies in four days of inspections of multiple cannabis cultivation sites in Humboldt County, on September 3-6, 2019. Inspection objectives for Regional Water Board staff included observing site development and activities and identifying and assessing onsite features or conditions that are causing or may cause adverse impacts to the quality and beneficial uses of receiving waters, including surface and ground water.

**Inspection Map**

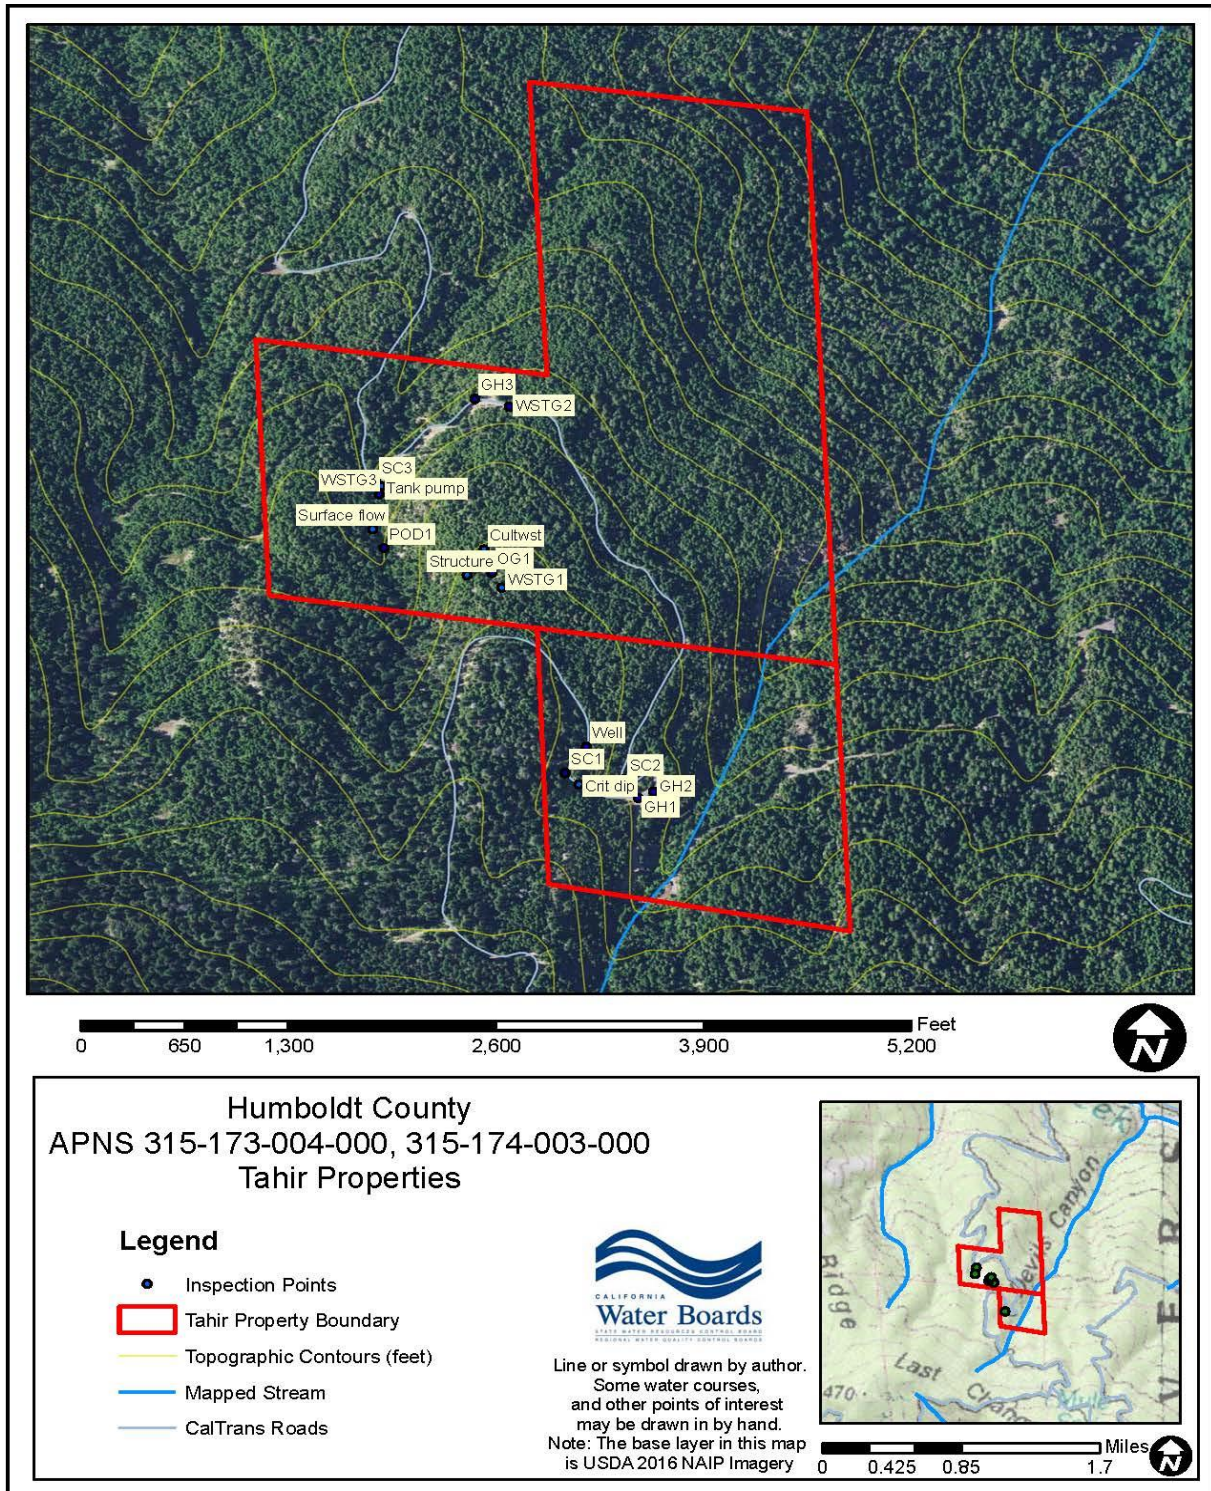


Figure 1 inspection map with inspection points

**Inspection Observations:**

On September 4, 2019, I inspected the subject property. Figure 1, above, shows the inspection points discussed below, including GH1, GH2, GH3, OG1, SC1, SC2, SC3, Well, Crit Dip, WSTG1, WSTG2, WST3, Cultwst, POD1, Surface flow and Tank pump. In addition to those features marked on the inspection map, we observed, and photo-documented green houses, human waste, stream crossings, water storages, cultivation waste and other issues of water quality concern.

GH1 and GH2 (photos 4 and 5 respectively), the first cultivation area we inspected, is located about 700 feet north from the southern property line, accessed via the southeastern access road. This area has a flat topography covering an approximate area of 3,000 square feet, with three hoop houses. In this area, I observed uncontained trash, plastic containers, and wastes (photos 6). OG1 (photo 9), located approximately 2,000 feet northwest of GH2, is an old cultivation area with no active cannabis cultivation activities. Approximately 1,200 feet north of OG1, I observed GH3 (Photo 10), an active cultivation area of 600 square feet. I also observed a toilet, water tanks, water pumps, and cultivation waste in the vicinity of the cultivation areas (photos 5,7,13).

In addition to the cannabis cultivation areas, I observed stream crossings SC1, SC2, SC3. Crossing SC1 (photo 1) is about 1600 feet from the southern property line. The road is built through a Class III watercourse at this location, with an undersized, plugged, and rusted corrugated metal pipe culvert. I observed evidence of sediment delivery into the watercourse at this crossing. SC2 (Photo 2) is a Class III stream crossing on the southern access road, approximately 400 feet to the east of SC1, with no constructed feature to provide stable conveyance for stream flows. I observed evidence of erosion and sediment discharge into the watercourse. SC3 is approximately 2,500 feet Northwest of SC2 (photo 15), blown out stream crossing, delivered about 1,500 cubic yards of sediment to the class II watercourse.

<i>Map point</i>	<i>Feature</i>	<i>Brief Description</i>	<i>Water Quality Concern</i>	<i>Associated Photo(s)</i>
GH1,GH2 and GH3	Cannabis cultivation areas	2 greenhouses and one open cultivation area with active cannabis cultivation; outhouse, water pumps, chemicals, trash, and other wastes nearby.	Cannabis cultivation without report of waste discharge and/or enrollment in Water Boards cannabis program. Threatened discharge of waste to waters of the state	Photos 4,5,6,10,11 and 18
OG1	Old cannabis cultivation area	2 green houses with no active cultivation; old cultivation wastes nearby.	Threatened discharge of waste to water of the state	Photos 9 and 14
SC1	Stream crossing	Road built through Class III watercourse; evidence of sediment delivery.	Construction- related earthen material placed in or where it can enter surface water. Dredge/fill in waters of the State. Discharge and threatened discharge of waste to receiving waters.	Photo 1
SC2	Stream crossing	Road built through Class III watercourse; evidence of sediment delivery.	Construction- related earthen material placed in or where it can enter surface water. Dredge/fill in waters of the State. Discharge and threatened discharge of waste to receiving waters.	Photo 2

<i>Map point</i>	<i>Feature</i>	<i>Brief Description</i>	<i>Water Quality Concern</i>	<i>Associated Photo(s)</i>
SC3	Stream crossing	Road built through Class II watercourse; evidence of sediment delivery.	Construction- related earthen material placed in or where it can enter surface water. Dredge/fill in waters of the State. Discharge and threatened discharge of waste to receiving waters.	Photo 15
WSTG1	Water storage tanks	Water storage tanks on a steep slope	Threatened discharge of waste to receiving waters.	Photo 3
WSTG2	Water storage tanks	Water storage tanks on a steep slope and nearby water pump	Threatened discharge of waste to receiving waters.	Photo 12, and 13
Well	Well	Ground water well	N/A	Photo 7
Surface flow	Tank and water pump in a Class II watercourse	Storage tank and water pump inside a class II watercourse with water flow	Construction- related earthen material placed in or where it can enter surface water. Dredge/fill in waters of the State. Discharge and threatened discharge of waste to receiving waters.	Photo 16
POD1	Point of diversion	Unpermitted point of diversion	Construction- related earthen material placed in or where it can enter surface water. Dredge/fill in waters of the State. Discharge and threatened discharge of waste to receiving waters.	Photo 17

**A comparison of conditions observed on the site with categories of activities typically associated with water quality concerns at cannabis cultivation sites:**

1. Site maintenance, erosion control and drainage features: I observed a poorly designed access road with a potential of delivering sediment to the waters of the state.
2. Stream crossing maintenance and improvement: I observed 3 stream crossings (SC1, SC2, and SC3) on the access road to the property; as discussed above, all were constructed either improperly or without any structure or design to protect water quality. All three crossings are causing or resulting in active discharge of sediment to class II and III watercourses. (Photos 1,2 and 15)
3. Stream and wetland buffers: I observed water storage tanks on a steep slope near a class II watercourse. (Photo 12,13 and 16)
4. Spoils management: I observed uncontained/ uncovered. (Photo 6, and 18)
5. Water storage and use: I observed storage tanks on a very steep unstable location which may fail and deliver sediments to waters of the state. (Photo 3)
6. Irrigation runoff: I observed no evidence of water quality issues associated with crop irrigation practices.
7. Fertilizers and soil amendments: I observed no evidence of water quality issues associated with fertilizers and soil amendment storage and/or use.
8. Pesticides: I observed no evidence of water quality concerns associated with storage and use of pesticides.
9. Petroleum products and other chemicals: I observed uncontained petroleum containers. (Photo 18)
10. Cultivation-related wastes I observed uncovered and/or uncontained cultivation-related wastes at inspection points Cultwst and OG1. Photo 14)
11. Refuse and human waste: I observed an outhouse toilet. (photo 11)

## **Recommendations**

1. Retain a licensed professional to inventory, assess, and develop a workplan and schedule to implement measures to ensure that all developed features, roads, watercourse crossings, and cultivation areas throughout the Property are corrected, restored, and/or maintained in conditions that prevent or minimize erosion, sediment transport/delivery, and adverse impacts to water quality and beneficial uses. Include measures to ensure that unstable features caused or affected by onsite development and operations are removed or otherwise protected so as to minimize the potential for these features to cause adverse impacts to water quality and beneficial uses. Dispose of all development and restoration-related earthen spoils in a manner to prevent/minimize transport and delivery to receiving waters.
2. Work with CDFW and the State Water Resources Control Board's Division of Water Rights (DIV) to determine and secure any applicable permits or licensing required for surface water diversion, storage, and use on the site. If the existing surface water diversions do not meet applicable CDFW or DIV requirements, remove diversion infrastructure from surface waters and ensure that restoration plans developed pursuant to Recommendation 1, above, include provisions for restoring any instream or riparian disturbance associated with this features or removal thereof.
3. Prior to conducting any instream work associated with recommendation 1, above, submit to the Regional Water Board an application for Clean Water Act section 401 water quality certification, and secure approval from the Regional Water Board.

The 401 Application may be found at the following hyperlink:

[https://www.waterboards.ca.gov/northcoast/water\\_issues/programs/wqc\\_docs/031616\\_401-Application.pdf](https://www.waterboards.ca.gov/northcoast/water_issues/programs/wqc_docs/031616_401-Application.pdf)

4. If the property owner and/or tenant(s) choose to continue to cultivate cannabis, transfer enrollment for coverage under and take steps to comply with the requirements of the CANGO (Order WQ 2019-0001-DWQ, General Waste Discharge Requirements and Waiver of Waste Discharge Requirements for Discharges of Waste Associated with Cannabis Cultivation Activities). More information about the CANGO can be found at this hyperlink:

[https://www.waterboards.ca.gov/board\\_decisions/adopted\\_orders/water\\_quality/2019/wqo2019\\_0001\\_dwq.pdf](https://www.waterboards.ca.gov/board_decisions/adopted_orders/water_quality/2019/wqo2019_0001_dwq.pdf)

5. In the event that the property owner and/or tenant(s) propose in the future to develop or use the Property in a manner or method that will or may result in a discharge of waste to waters of the state in the future, staff recommend that the owner(s)/tenant(s) be aware of and comply with relevant regulatory requirements for water quality protection. For example, Water Code section 13260 requires that a person discharging waste, or proposing to discharge waste, within any region that could affect the quality of the waters of the state, other than into a community sewer system shall file with the appropriate regional board a report of the discharge. Further, Water Code section 13264 states, in part: "No person shall initiate any new discharge of waste or make any material changes in any discharge...prior to the filing of the report required by Section 13260." In addition, projects involving the disturbance of an acre or more of land are subject to regulation under the State Water Board's Construction General Stormwater permit, and projects involving dredge or fill in waters of the United States are subject to regulation under Clean Water Act section 401. You may find further information about Water Board permits that may apply to proposed site development or land use activities at this hyperlink:

[https://www.waterboards.ca.gov/northcoast/water\\_issues/programs/permit/](https://www.waterboards.ca.gov/northcoast/water_issues/programs/permit/)

6. Discontinue use of and dismantle any outhouse/pit toilet features and work with Humboldt County to ensure that all domestic and human wastes are collected and disposed of consistent with applicable County requirements.
7. Collect and dispose of or contain all refuse and cultivation-related wastes in a location and manner so as to minimize potential for these wastes to enter or be transported into receiving waters.
8. Store and contain all chemicals, including petroleum, fertilizer and/or pesticides properly to prevent spillage and discharge to receiving waters. Provide secondary containment for all petroleum products.

**Enforcement Discretion:**

The observations in this report will be assessed for violations of the California Water Code. The Regional Water Board and the State Water Board reserve the rights to take any enforcement action authorized by law.

**PHOTO APPENDIX**



Photo 1 stream crossing 1 at inspection point SC1



Photo 2 stream crossing 2 at inspection point SC2



Photo 3 water storage tanks at inspection point WSTG1



Photo 4 Cannabis cultivation area at inspection point GH1



Photo 5 Cannabis cultivation area at inspection point GH2



Photo 6 Uncontained propane containers near GH1



Photo 7, well head at inspection point Well



Photo 8 uncontained pump at inspection point Tank pump



Photo 9 unused former cultivation site at inspection point OG1



Photo 10 cannabis cultivation at inspection point GH3



Photo 11 outhouse toilet near inspection point GH3



Photo 12, Uncontained pump near inspection point WSTG2



Photo 13, Water storage tanks and irrigation pump at inspection point WST2



Photo 14, Cultivation waste at inspection point Cultwst



Photo 15 blown out stream crossing at inspection point SC3



Photo 16 water storage tank and a pump at inspection point Surface flow



Photo 17, Point of Diversion at inspection point POD1



Photo 18, uncontained plastic petroleum containers near inspection point GH1



Photo 19, Threatened sediment delivery from the road near SC2